



INVERTER ARC WELDER

MODEL PS4000

- Plasma Arc Welding

OPERATING MANUAL

TABLE OF CONTENTS

1.0 GENERAL INFORMATION	5
1.01 NOTES, CAUTIONS AND WARNINGS	5
WARNING	
1.02 IMPORTANT SAFETY PRECAUTIONS	6
IMPORTANT SAFETY PRECAUTIONS (CONTINUED)	7
IMPORTANT SAFETY PRECAUTIONS (CONTINUED)	8
1.03 PUBLICATIONS	9
1.04 NOTE, ATTENTION ET AVERTISSEMENT	10
AVERTISSEMENT	
1.05 PRECAUTIONS DE SECURITE IMPORTANTES	11
PRECAUTIONS DE SECURITE IMPORTANTES	12
PRECAUTIONS DE SECURITE IMPORTANTES	13
1.06 DOCUMENTS DE REFERENCE	14
1.08 STATEMENT OF WARRANTY	15
2.0 INTRODUCTION AND DESCRIPTION	17
2.01 Description	17
2.02 Functional Block Diagrams	18
2.03 Transporting Methods	19
2.04 Electrical Input Connections	19
2.05 Specifications	22
2.06 Duty Cycle	23
3.0 OPERATOR CONTROLS	24
3.01 Front and Rear operator controls	24
3.02 Setup for Operation	26
3.02 Setup for Operation	27
Plasma Arc Welding (PAW)	27
4.0 BASIC TROUBLESHOOTING	28
4.01 Common Welding Operation Faults	28
4.02 Specific Problems	28
4.03 Remote 14-Pin Connections	32
4.03 Remote 17-Pin Connections	33
APPENDIX A – SYSTEM CONFIGURATION	34

TABLE OF CONTENTS

REPLACEMENT PARTS	35
SYSTEM SCHEMATIC - 230/460	38
SYSTEM SCHEMATIC - 380-415	39
SYSTEM SCHEMATIC - 460/575	40



WARNING Read and understand this entire Operating Manual and your employer's safety practices before installing, operating, or servicing the equipment.



WARNING While the information contained in this Operating Manual represents our best judgement, Thermal Dynamics Corporation assumes no liability for its use.

Thermal Arc Models PS4000 CC Plasma Arc Welder
Operating Manual Number

Published by:
Thermal Arc Inc.
2200 Corporate Dr.
Troy, Ohio, USA 45373
(937)440-0100

Copyright 2000 by
Thermal Arc Inc.

All rights reserved.

Reproduction of this work, in whole or in part, without written permission of the publisher is prohibited.

The publisher does not assume and hereby disclaims any liability to any party for any loss or damage caused by any error or omission in this Operating Manual, whether such error results from negligence, accident, or any other cause.

Printed in the United States of America

July 1, 2000

1.0 GENERAL INFORMATION

1.01 NOTES, CAUTIONS AND WARNINGS

Throughout this manual, notes, cautions, and warnings are used to highlight important information. These highlights are categorized as follows:

NOTE An operation, procedure, or background information which requires additional emphasis or is helpful in efficient operation of the system.

CAUTION

A procedure which, if not properly followed, may cause damage to the equipment.



WARNING

A procedure which, if not properly followed, may cause injury to the operator or others in the operating area.



WARNING

1.02 IMPORTANT SAFETY PRECAUTIONS

OPERATION AND MAINTENANCE OF PLASMA ARC EQUIPMENT
CAN BE DANGEROUS AND HAZARDOUS TO YOUR HEALTH.

To prevent possible injury, read, understand and follow all warnings, safety precautions and instructions before using the equipment. Call 1-937-440-0100 or your local distributor if you have any questions.

GASES AND FUMES

Gases and fumes produced during the plasma welding process can be dangerous and hazardous to your health.



- Keep all fumes and gases from the breathing area. Keep your head out of the welding fume plume.
- Use an air-supplied respirator if ventilation is not adequate to remove all fumes and gases.
- The kinds of fumes and gases from the plasma arc depend on the kind of metal being used, coatings on the metal, and the different processes. You must be very careful when cutting or welding any metals which may contain one or more of the following:

Antimony	Chromium	Mercury
Arsenic	Cobalt	Nickel
Barium	Copper	Selenium
Beryllium	Lead	Silver
Cadmium	Manganese	Vanadium

- Always read the Material Safety Data Sheets (MSDS) that should be supplied with the material you are using. These MSDSs will give you the information regarding the kind and amount of fumes and gases that may be dangerous to your health.
- For information on how to test for fumes and gases in your workplace, refer to item 1 in the Publications Section in this manual.
- Use special equipment, such as water or down draft tables, to capture fumes and gases.
- Do not use the plasma torch in an area where combustible or explosive gases or materials are located.
- Phosgene, a toxic gas, is generated from the vapors of chlorinated solvents and cleansers. Remove all sources of these vapors.

IMPORTANT SAFETY PRECAUTIONS (CONTINUED)

ELECTRIC SHOCK



Electric Shock can injure or kill. The plasma arc process uses and produces high voltage electrical energy. This electric energy can cause severe or fatal shock to the operator or others in the workplace.

- Never touch any parts that are electrically “live” or “hot.”
- Wear dry gloves and clothing. Insulate yourself from the work piece or other parts of the welding circuit.
- Repair or replace all worn or damaged parts.
- Extra care must be taken when the workplace is moist or damp.
- Install and maintain equipment according to NEC code, refer to item 4 in the Publications section of this manual.
- Disconnect power source before performing any service or repairs.
- Read and follow all the instructions in the Operating Manual.

FIRE AND EXPLOSION



Fire and explosion can be caused by hot slag, sparks, or the plasma arc.

- Be sure there is no combustible or flammable material in the workplace. Any material that cannot be removed must be protected.
- Ventilate all flammable or explosive vapors from the workplace.
- Do not cut or weld on containers that may have held combustibles.
- Provide a fire watch when working in an area where fire hazards may exist.
- Hydrogen gas may be formed and trapped under aluminum workpieces when they are cut underwater or while using a water table. **DO NOT** cut aluminum alloys underwater or on a water table unless the hydrogen gas can be eliminated or dissipated. Trapped hydrogen gas that is ignited will cause an explosion.

NOISE



Noise can cause permanent hearing loss. Plasma arc processes can cause noise levels to exceed safe limits. You must protect your ears from loud noise to prevent permanent loss of hearing.

- To protect your hearing from loud noise, wear protective ear plugs and/or ear muffs. Protect others in the workplace.
- Noise levels should be measured to be sure the decibels (sound) do not exceed safe levels.
- For information on how to test for noise, see item 1 in the Publications section of this manual.

IMPORTANT SAFETY PRECAUTIONS (CONTINUED)

PLASMA ARC RAYS



Plasma Arc Rays can injure your eyes and burn your skin. The plasma arc process produces very bright ultra violet and infra red light. These arc rays will damage your eyes and burn your skin if you are not properly protected.

- To protect your eyes, always wear a welding helmet or shield. Also always wear safety glasses with side shields, goggles or other protective eye wear.
- Wear welding gloves and suitable clothing to protect your skin from the arc rays and sparks.
- Keep helmet and safety glasses in good condition. Replace lenses when cracked, chipped or dirty.
- Protect others in the work area from the arc rays. Use protective booths, screens or shields.
- Use the shade of lens as recommended in the Operating Manual.

1.03 PUBLICATIONS

Refer to the following standards or their latest revisions for more information:

1. OSHA, SAFETY AND HEALTH STANDARDS, 29CFR 1910, obtainable from the Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402
2. ANSI Standard Z49.1, SAFETY IN WELDING AND CUTTING, obtainable from the American Welding Society, 550 N.W. LeJeune Rd, Miami, FL 33126
3. NIOSH, SAFETY AND HEALTH IN ARC WELDING AND GAS WELDING AND CUTTING, obtainable from the Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402
4. ANSI Standard Z87.1, SAFE PRACTICES FOR OCCUPATION AND EDUCATIONAL EYE AND FACE PROTECTION, obtainable from American National Standards Institute, 1430 Broadway, New York, NY 10018
5. ANSI Standard Z41.1, STANDARD FOR MEN'S SAFETY-TOE FOOTWEAR, obtainable from the American National Standards Institute, 1430 Broadway, New York, NY 10018
6. ANSI Standard Z49.2, FIRE PREVENTION IN THE USE OF CUTTING AND WELDING PROCESSES, obtainable from American National Standards Institute, 1430 Broadway, New York, NY 10018
7. AWS Standard A6.0, WELDING AND CUTTING CONTAINERS WHICH HAVE HELD COMBUSTIBLES, obtainable from American Welding Society, 550 N.W. LeJeune Rd, Miami, FL 33126
8. NFPA Standard 51, OXYGEN-FUEL GAS SYSTEMS FOR WELDING, CUTTING AND ALLIED PROCESSES, obtainable from the National Fire Protection Association, Batterymarch Park, Quincy, MA 02269
9. NFPA Standard 70, NATIONAL ELECTRICAL CODE, obtainable from the National Fire Protection Association, Batterymarch Park, Quincy, MA 02269
10. NFPA Standard 51B, CUTTING AND WELDING PROCESSES, obtainable from the National Fire Protection Association, Batterymarch Park, Quincy, MA 02269
11. CGA Pamphlet P-1, SAFE HANDLING OF COMPRESSED GASES IN CYLINDERS, obtainable from the Compressed Gas Association, 1235 Jefferson Davis Highway, Suite 501, Arlington, VA 22202
12. CSA Standard W117.2, CODE FOR SAFETY IN WELDING AND CUTTING, obtainable from the Canadian Standards Association, Standards Sales, 178 Rexdale Boulevard, Rexdale, Ontario, Canada M9W 1R3
13. NWSA booklet, WELDING SAFETY BIBLIOGRAPHY obtainable from the National Welding Supply Association, 1900 Arch Street, Philadelphia, PA 19103
14. American Welding Society Standard AWSF4.1, RECOMMENDED SAFE PRACTICES FOR THE PREPARATION FOR WELDING AND CUTTING OF CONTAINERS AND PIPING THAT HAVE HELD HAZARDOUS SUBSTANCES, obtainable from the American Welding Society, 550 N.W. LeJeune Rd, Miami, FL 33126
15. ANSI Standard Z88.2, PRACTICE FOR RESPIRATORY PROTECTION, obtainable from American National Standards Institute, 1430 Broadway, New York, NY 10018

1.04 NOTE, ATTENTION ET AVERTISSEMENT

Dans ce manuel, les mots “note,” “attention,” et “avertissement” sont utilisés pour mettre en relief des informations à caractère important. Ces mises en relief sont classifiées comme suit :

NOTE Toute opération, procédure ou renseignement général sur lequel il importe d’insister davantage ou qui contribue à l’efficacité de fonctionnement du système.

ATTENTION

Toute procédure pouvant résulter l’endommagement du matériel en cas de non-respect de la procédure en question.

AVERTISSEMENT



Toute procédure pouvant provoquer des blessures de l’opérateur ou des autres personnes se trouvant dans la zone de travail en cas de non-respect de la procédure en question.



AVERTISSEMENT

1.05 PRECAUTIONS DE SECURITE IMPORTANTES

L'OPÉRATION ET LA MAINTENANCE DU MATÉRIEL DE SOUDAGE À L'ARC AU JET DE PLASMA PEUVENT PRÉSENTER DES RISQUES ET DES DANGERS DE SANTÉ.

Il faut communiquer aux opérateurs et au personnel TOUS les dangers possibles. Afin d'éviter les blessures possibles, lisez, comprenez et suivez tous les avertissements, toutes les précautions de sécurité et toutes les consignes avant d'utiliser le matériel. Composez le + 603-298-5711 ou votre distributeur local si vous avez des questions.

FUMÉE et GAZ



La fumée et les gaz produits par le procédé de jet de plasma peuvent présenter des risques et des dangers de santé.

- Eloignez toute fumée et gaz de votre zone de respiration. Gardez votre tête hors de la plume de fumée provenant du chalumeau.
- Utilisez un appareil respiratoire à alimentation en air si l'aération fournie ne permet pas d'éliminer la fumée et les gaz.
- Les sortes de gaz et de fumée provenant de l'arc de plasma dépendent du genre de métal utilisé, des revêtements se trouvant sur le métal et des différents procédés. Vous devez prendre soin lorsque vous coupez ou soudez tout métal pouvant contenir un ou plusieurs des éléments suivants:

antimoine	cadmium	mercure
argent	chrome	nickel
arsenic	cobalt	plomb
baryum	cuiivre	sélénium
béryllium	manganèse	vanadium
- Lisez toujours les fiches de données sur la sécurité des matières (sigle américain "MSDS"); celles-ci devraient être fournies avec le matériel que vous utilisez. Les MSDS contiennent des renseignements quant à la quantité et la nature de la fumée et des gaz pouvant poser des dangers de santé.
- Pour des informations sur la manière de tester la fumée et les gaz de votre lieu de travail, consultez l'article 1 et les documents cités à la page 11.
- Utilisez un équipement spécial tel que des tables de coupe à débit d'eau ou à courant descendant pour capter la fumée et les gaz.
- N'utilisez pas le chalumeau au jet de plasma dans une zone où se trouvent des matières ou des gaz combustibles ou explosifs.
- Le phosgène, un gaz toxique, est généré par la fumée provenant des solvants et des produits de nettoyage chlorés. Éliminez toute source de

telle fumée.

PRECAUTIONS DE SECURITE IMPORTANTES

CHOC ELECTRIQUE



Les chocs électriques peuvent blesser ou même tuer. Le procédé au jet de plasma requiert et produit de l'énergie électrique haute tension. Cette énergie électrique peut produire des chocs graves, voire mortels, pour l'opérateur et les autres personnes sur le lieu de travail.

- Ne touchez jamais une pièce "sous tension" ou "vive"; portez des gants et des vêtements secs. Isolez-vous de la pièce de travail ou des autres parties du circuit de soudage.
- Réparez ou remplacez toute pièce usée ou endommagée.
- Prenez des soins particuliers lorsque la zone de travail est humide ou moite.
- Montez et maintenez le matériel conformément au Code électrique national des Etats-Unis. (Voir la page 6, article 9.)
- Débranchez l'alimentation électrique avant tout travail d'entretien ou de réparation.
- Lisez et respectez toutes les consignes du Manuel de consignes.

INCENDIE ET EXPLOSION



Les incendies et les explosions peuvent résulter des scories chaudes, des étincelles ou de l'arc de plasma. Le procédé à l'arc de plasma produit du métal, des étincelles, des scories chaudes pouvant mettre le feu aux matières combustibles ou provoquer l'explosion de fumées inflammables.

- Soyez certain qu'aucune matière combustible ou inflammable ne se trouve sur le lieu de travail. Protégez toute telle matière qu'il est impossible de retirer de la zone de travail.
- Procurez une bonne aération de toutes les fumées inflammables ou explosives.
- Ne coupez pas et ne soudez pas les conteneurs ayant pu renfermer des matières combustibles.
- Prévoyez une veille d'incendie lors de tout travail dans une zone présentant des dangers d'incendie.
- Le gas hydrogène peut se former ou s'accumuler sous les pièces de travail en aluminium lorsqu'elles sont coupées sous l'eau ou sur une table d'eau. NE PAS couper les alliages en aluminium sous l'eau ou sur une table d'eau à moins que le gas hydrogène peut s'échapper ou se dissiper. Le gas hydrogène accumulé explosera si enflammé.

PRECAUTIONS DE SECURITE IMPORTANTES

RAYONS D'ARC DE PLASMA



Les rayons provenant de l'arc de plasma peuvent blesser vos yeux et brûler votre peau. Le procédé à l'arc de plasma produit une lumière infra-rouge et des rayons ultra-violetts très forts. Ces rayons d'arc nuiront à vos yeux et brûleront votre peau si vous ne vous protégez pas correctement.

- Pour protéger vos yeux, portez toujours un casque ou un écran de soudeur. Portez toujours des lunettes de sécurité munies de parois latérales ou des lunettes de protection ou une autre sorte de protection oculaire.
- Portez des gants de soudeur et un vêtement protecteur approprié pour protéger votre peau contre les étincelles et les rayons de l'arc.



- Maintenez votre casque et vos lunettes de protection en bon état. Remplacez toute lentille sale ou comportant fissure ou rognure.
- Protégez les autres personnes se trouvant sur la zone de travail contre les rayons de l'arc en fournissant des cabines ou des écrans de protection.
- Respectez le teint de lentille recommandé dans le manuel de consignes.

BRUIT

Le bruit peut provoquer une perte permanente de l'ouïe. Les procédés de soudage à l'arc de plasma peuvent provoquer des niveaux sonores supérieurs aux limites normalement acceptables. Vous devez vous protéger les oreilles contre les bruits forts afin d'éviter une perte permanente de l'ouïe.

- Pour protéger votre ouïe contre les bruits forts, portez des tampons protecteurs et/ou des protections auriculaires. Protégez également les autres personnes se trouvant sur le lieu de travail.
- Il faut mesurer les niveaux sonores afin d'assurer que les décibels (le bruit) ne dépassent pas les niveaux sûrs.
- Pour des renseignements sur la manière de tester le bruit, consultez l'article 1, page 11.

1.06 DOCUMENTS DE REFERENCE

Consultez les normes suivantes ou les révisions les plus récentes ayant été faites à celles-ci pour de plus amples renseignements :

1. OSHA, NORMES DE SÉCURITÉ DU TRAVAIL ET DE PROTECTION DE LA SANTÉ, 29CFR 1910, disponible auprès du Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402
2. Norme ANSI Z49.1, LA SÉCURITÉ DES OPÉRATIONS DE COUPE ET DE SOUDAGE, disponible auprès de la Société Américaine de Soudage (American Welding Society), 550 N.W. LeJeune Rd., Miami, FL 33126
3. NIOSH, LA SÉCURITÉ ET LA SANTÉ LORS DES OPÉRATIONS DE COUPE ET DE SOUDAGE À L'ARC ET AU GAZ, disponible auprès du Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402
4. Norme ANSI Z87.1, PRATIQUES SURES POUR LA PROTECTION DES YEUX ET DU VISAGE AU TRAVAIL ET DANS LES ECOLES, disponible de l'Institut Américain des Normes Nationales (American National Standards Institute), 1430 Broadway, New York, NY 10018
5. Norme ANSI Z41.1, NORMES POUR LES CHAUSSURES PROTECTRICES, disponible auprès de l'American National Standards Institute, 1430 Broadway, New York, NY 10018
6. Norme ANSI Z49.2, PRÉVENTION DES INCENDIES LORS DE L'EMPLOI DE PROCÉDÉS DE COUPE ET DE SOUDAGE, disponible auprès de l'American National Standards Institute, 1430 Broadway, New York, NY 10018
7. Norme A6.0 de l'Association Américaine du Soudage (AWS), LE SOUDAGE ET LA COUPE DE CONTENEURS AYANT RENFERMÉ DES PRODUITS COMBUSTIBLES, disponible auprès de la American Welding Society, 550 N.W. LeJeune Rd., Miami, FL 33126
8. Norme 51 de l'Association Américaine pour la Protection contre les Incendies (NFPA), LES SYSTEMES À GAZ AVEC ALIMENTATION EN OXYGENE POUR LE SOUDAGE, LA COUPE ET LES PROCÉDÉS ASSOCIÉS, disponible auprès de la National Fire Protection Association, Batterymarch Park, Quincy, MA 02269
9. Norme 70 de la NFPA, CODE ELECTRIQUE NATIONAL, disponible auprès de la National Fire Protection Association, Batterymarch Park, Quincy, MA 02269
10. Norme 51B de la NFPA, LES PROCÉDÉS DE COUPE ET DE SOUDAGE, disponible auprès de la National Fire Protection Association, Batterymarch Park, Quincy, MA 02269
11. Brochure GCA P-1, LA MANIPULATION SANS RISQUE DES GAZ COMPRIMÉS EN CYLINDRES, disponible auprès de l'Association des Gaz Comprimés (Compressed Gas Association), 1235 Jefferson Davis Highway, Suite 501, Arlington, VA 22202
12. Norme CSA W117.2, CODE DE SÉCURITÉ POUR LE SOUDAGE ET LA COUPE, disponible auprès de l'Association des Normes Canadiennes, Standards Sales, 178 Rexdale Boulevard, Rexdale, Ontario, Canada, M9W 1R3
13. ivret NWSA, BIBLIOGRAPHIE SUR LA SÉCURITÉ DU SOUDAGE, disponible auprès de l'Association Nationale de Fournitures de Soudage (National Welding Supply Association), 1900 Arch Street, Philadelphia, PA 19103
14. Norme AWSF4.1 de l'Association Américaine de Soudage, RECOMMANDATIONS DE PRATIQUES SURES POUR LA PRÉPARATION À LA COUPE ET AU SOUDAGE DE CONTENEURS ET TUYAUX AYANT RENFERMÉ DES PRODUITS DANGEREUX, disponible auprès de la American Welding Society, 550 N.W. LeJeune Rd., Miami, FL 33126
15. Norme ANSI Z88.2, PRATIQUES DE PROTECTION RESPIRATOIRE, disponible auprès de l'American National Standards Institute, 1430 Broadway, New York, NY 10018

1.08 STATEMENT OF WARRANTY

LIMITED WARRANTY: Thermal Arc®; Inc., A Thermadyne Company, hereafter, “Thermal Arc” warrants to customers of its authorized distributors hereafter “Thermal; Arc” that its products will be free of defects in workmanship or material. Should any failure to conform to this warranty appear within the time period applicable to the Thermal Arc products as stated below, Thermal Arc shall, upon notification thereof and substantiation that the product has been stored, installed, operated, and maintained in accordance with Thermal Arc’s specifications, instructions, recommendations and recognized standard industry practice, and not subject to misuse, repair, neglect, alteration, or accident, correct such defects by suitable repair or replacement, at Thermal Arc’s sole option, of any components or parts of the product determined by Thermal Arc to be defective.

THERMAL ARC MAKES NO OTHER WARRANTY, EXPRESS OR IMPLIED. THIS WARRANTY IS EXCLUSIVE AND IN LIEU OF ALL OTHERS, INCLUDING, BUT NOT LIMITED TO ANY WARRANTY OF MERCHANTABILITY OR FITNESS FOR ANY PARTICULAR PURPOSE.

LIMITATION OF LIABILITY: Thermal Arc shall not under any circumstances be liable for special, indirect or consequential damages, such as, but not limited to, lost profits and business interruption. The remedies of the Purchaser set forth herein are exclusive and the liability of Thermal Arc with respect to any contract, or anything done in connection therewith such as the performance or breach thereof, or from the manufacture, sale, delivery, resale, or use of any goods covered by or furnished by Thermal Arc whether arising out of contract, negligence, strict tort, or under any warranty, or otherwise, shall not, except as expressly provided herein, exceed the price of the goods upon which such liability is based. No employee, agent, or representative of Thermal Arc is authorized to change this warranty in any way or grant any other warranty.

PURCHASER’S RIGHTS UNDER THIS WARRANTY ARE VOID IF REPLACEMENT PARTS OR ACCESSORIES ARE USED WHICH IN THERMAL ARC’S SOLE JUDGEMENT MAY IMPAIR THE SAFETY OR PERFORMANCE OF ANY THERMAL ARC PRODUCT. PURCHASER’S RIGHTS UNDER THIS WARRANTY ARE VOID IF THE PRODUCT IS SOLD TO PURCHASER BY NON-AUTHORIZED PERSONS.

The warranty is effective for the time stated below beginning on the date that the authorized distributor delivers the products to the Purchaser. Notwithstanding the foregoing, in no event shall the warranty period extend more than the time stated plus one year from the date Thermal Arc delivered the product to the authorized distributor.

	ALL OTHER	P-WEE, PRO-LITES	
POWER SUPPLIES	POWER SUPPLIES	PRO-PLUS, PRO-WAVE	LABOR
MAIN POWER MAGNETICS (STATIC & ROTATING)	3 YEARS	2 YEAR	1 YEAR
ORIGINAL MAIN POWER RECTIFIER	3 YEARS	2 YEAR	1 YEAR
CONTROL PC BOARD	3 YEARS	2 YEAR	1 YEAR
ALL OTHER CIRCUITS AND COMPONENTS INCLUDING BUT NOT LIMITED TO, CONTACTORS, RELAYS, SOLENOIDS, PUMPS, POWER SWITCHING SEMI-CONDUCTORS	1 YEAR	1 YEAR	1 YEAR
ENGINES: ENGINES ARE NOT WARRANTED BY THERMAL ARC, ALTHOUGH MOST ARE WARRANTED BY THE ENGINE MANUFACTURER, SEE THE ENGINE MANUFACTURES WARRANTY FOR DETAILS.			
CONSOLES, CONTROL EQUIPMENT, HEAT EXCHANGES, AND ACCESSORY EQUIPMENT	1 YEAR	1 YEAR	1 YEAR
TORCH AND LEADS	180 DAYS	180 DAYS	180DAYS
REPAIR/REPLACEMENT PARTS	90 DAYS	90 DAYS	90 DAYS

Warranty repairs or replacement claims under this limited warranty must be submitted to Thermal Arc by an authorized Thermal Arc repair facility within thirty (30) days of purchaser’s notice of any Warranty Claim. No transportation costs of any kind will be paid under this warranty. Transportation charges to send products to an authorized warranty repair facility shall be the responsibility of the Purchaser. All returned goods shall be at the Purchaser’s risk and expense. This warranty supersedes all previous Thermal Arc warranties.

Thermal Arc® is a Registered Trademark of Thermadyne Industries Inc.

Effective January 1, 1999





This page intentionally left blank

2.0 INTRODUCTION AND DESCRIPTION

2.01 Description

The Thermal Arc™ Model PS4000 is a three-phase or single-phase (if derated) DC arc welding power source with constant current output characteristics. This unit is designed for use with the Plasma Arc Welding (PAW) process. A digital meter displaying amperes and voltage is standard.

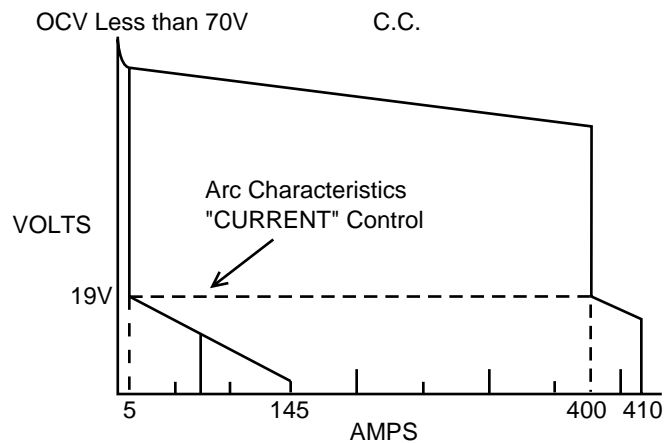


Figure 1. PS4000 model Volt-Ampere curves

NOTE Volt-Ampere curves show the maximum Voltage and Amperage output capabilities of the welding power source. Curves of other settings will fall between the curves shown.

2.02 Functional Block Diagrams

Figure 2 illustrates the functional block diagrams of the PS4000 power supplies.

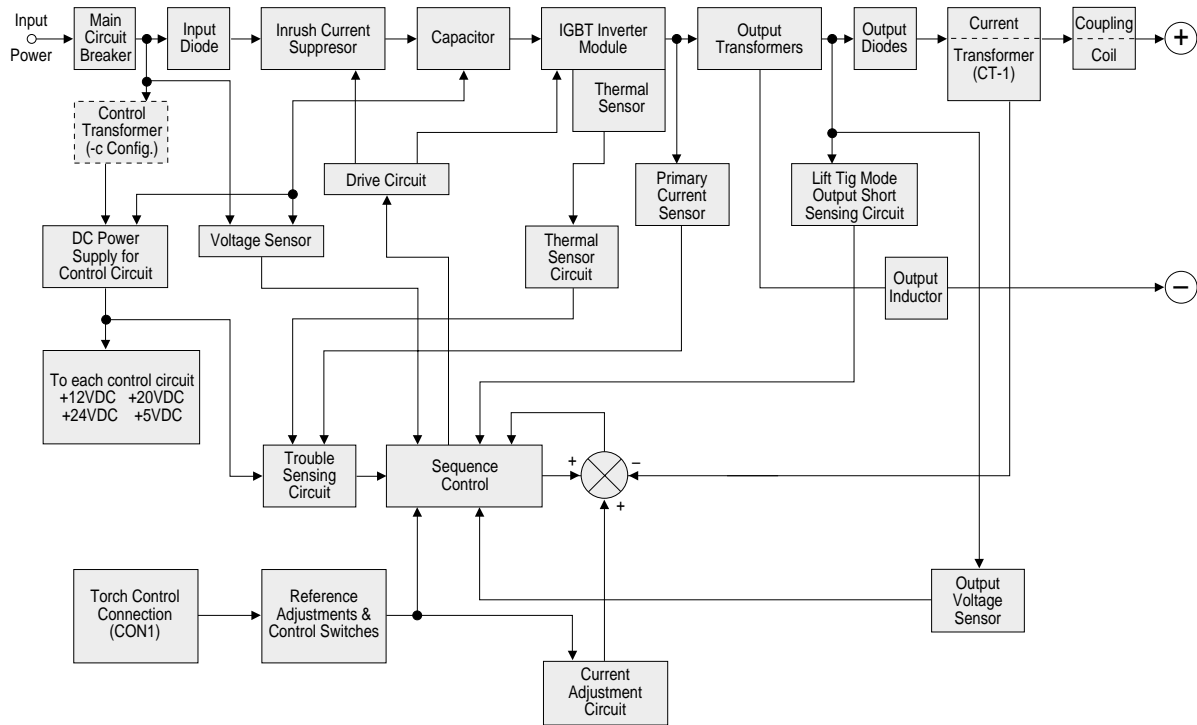



Figure 2. PS4000 Model functional block diagram

2.03 Transporting Methods


	These units are equipped with a handle for carrying purposes.
WARNING	ELECTRIC SHOCK can kill.

- DO NOT TOUCH live electrical parts.
- Disconnect input power conductors from de-energized supply line before moving welding power source.

	WARNING FALLING EQUIPMENT can cause serious personal injury and equipment damage.
---	---

- Lift unit with handle on top of case.
- Use hand cart or similar device of adequate capacity.
- If using a fork lift vehicle, place and secure unit on a proper skid before transporting.

2.04 Electrical Input Connections

	WARNING ELECTRIC SHOCK can kill; SIGNIFICANT DC VOLTAGE is present after removal of input power.
--	---

- DO NOT TOUCH live electrical parts.
- SHUT DOWN welding power source, disconnect input power employing lockout/tag out procedures. Lockout/tag out procedures consist of padlocking line disconnect switch in open position, removing fuses from fuse box, or shutting off and red-tagging circuit breaker or other disconnecting device.

Electrical Input Requirements

Operate the welding power source from a single or three-phase 50/60 Hz, AC power supply. The input voltage must match one of the electrical input voltages shown on the input data label on the unit nameplate. Contact the local electric utility for information about the type of electrical service available, how proper connections should be made, and inspection required.

The line disconnect switch provides a safe and convenient means to completely remove all electrical power from the welding power supply whenever necessary to inspect or service the unit.

NOTE These units are equipped with a four-conductor with earth power cable that is connected at the welding power source end for single or three-phase electrical input power.

- To operate single-phase, do not connect the RED input conductor.
- Do not connect an input (WHITE, BLACK or RED) conductor to the ground terminal.
- Do not connect the ground (GREEN) conductor to an input line terminal.

Refer to Figure 3 and:

1. Connect end of ground (GREEN) conductor to a suitable ground. Use a grounding method that complies with all applicable electrical codes.
2. Connect ends of line 1 (BLACK), line 2 (WHITE) and line 3 (RED) input conductors to a de-energized line disconnect switch.
3. Use Table 1 below as a guide to select line fuses for the disconnect switch.

Table 1. Fuse Size Selection

Input Power/Input Voltage	Fuse Size (Amperes)	
	Three-Phase	Single-Phase
208-230VAC	70	80
380-415 VAC	40	N/A
460 VAC	30	40

NOTE Fuse size is based on not more than 200 percent of the rated input amperage of the welding power source (Based on Article 630, National Electrical

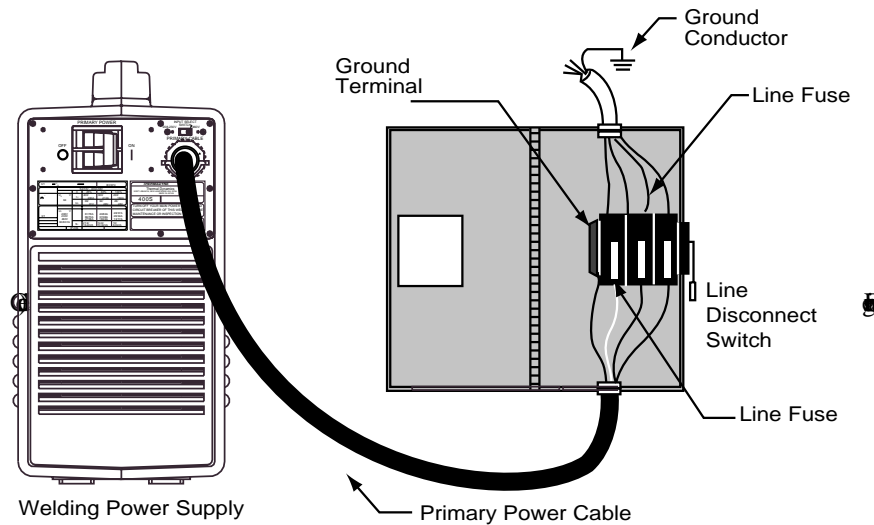


Figure 3. Electrical input connections

Input Power Each unit incorporates an INRUSH circuit and input voltage sensing circuit. When the MAIN CIRCUIT BREAKER is turned on, the inrush circuit provides a pre-charging of the input capacitors. SCR's in the Power Control Assembly (PCA) will turn on after the input capacitors have charged to full operating voltage (after approximately 5 seconds).

NOTE Note the available input power. Damage to the PCA could occur if 575VAC is applied to a 208-230/460 volt unit with the INPUT SELECT switch in the 208-230V position.

208VAC 50/60Hz three-phase/single-phase

230VAC 50/60Hz three-phase/single-phase

460VAC 50/60Hz three-phase/single-phase

575VAC 50/60Hz three-phase (only applies to 460/575 volt units)

2.05 Specifications

Parameter	PS4000		
Rated Output			
Amperes	400		300
Volts	36		32
Duty Cycle	25%		60%
Output Range (Min. - Max.)			
Amperes	5-400		
Volts	10-36		
Open Circuit Voltage			
Maximum OCV	73 V		
Input Data	50/60 Hz		
Dimensions/Weight			
Width	8.3 in (210 mm)		
Height	16.9 in (430 mm)		
Length	16.5 in (420 mm)		
Weight	41.8 lb (19 kg.)		
Output At Rated Load			
Input data 50/60 Hz/Duty Cycle			
Output Amperes	400		300
Output Volts	36		32
Duty Cycle	25%		60%
KVA	21.9		11.3
KW	16.9		11.3
Output At No Load			
Input data 50/60 Hz/Duty Cycle			
KVA	0.5		
KW	0.3		
Input Volts			
	Amperage Draw		No Load
	Rated Load		
Three-Phase			
208	61	40	1.4
230	55	37	1.3
380	33	32	0.8
400	32	21	0.7
415	30	20	0.7
460	27	18	0.6
575	22	15	0.5
Single-Phase			
208	48	65	1.6
230	51	68	1.5

2.06 Duty Cycle

The duty cycle of a welding power source is the percentage of a ten (10) minute period that it can be operated at a given output without causing overheating and damage to the unit. If the welding amperes decrease, the duty cycle increases. If the welding amperes are increased beyond the rated output, the duty cycle will decrease.



WARNING

Exceeding the duty cycle ratings will cause the thermal overload protection circuit to become energized and shut down the output until the unit has cooled to normal operating temperature.

Continually exceeding the duty cycle ratings can cause damage to the welding power source.

To calculate duty cycle:

$$\text{current} = \sqrt{\frac{(\text{rated current})^2 \times (\text{rated duty cycle})}{(\text{desired duty cycle})}}$$

i.e. At the 400A rated output current, and 25% rated duty cycle, the operator wants to work on a 50% duty cycle. The maximum allowable current draw is:

3.0 OPERATOR CONTROLS

3.01 Front and Rear operator controls

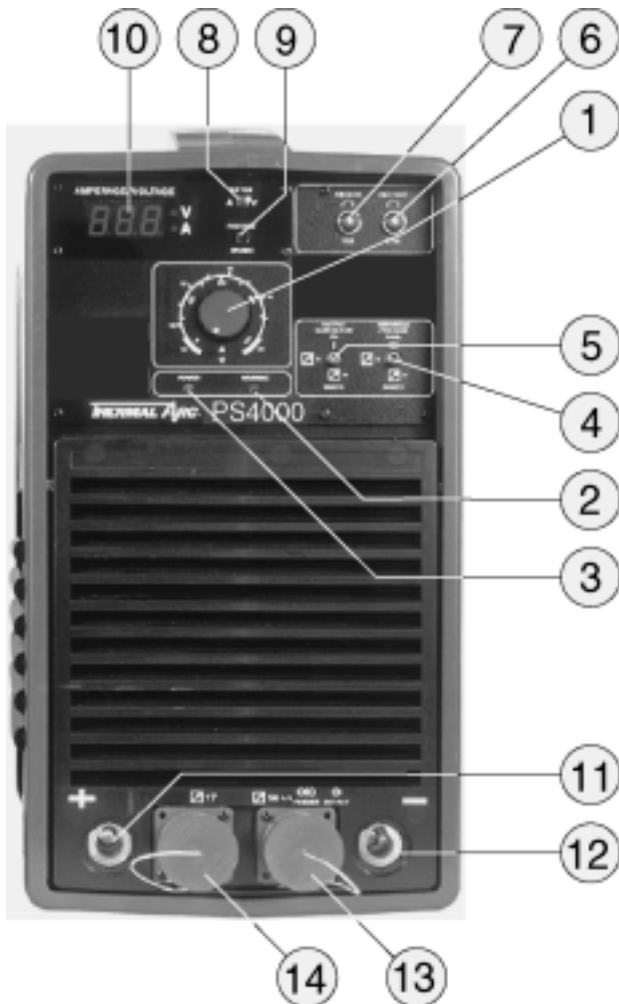


Figure 4. PS4000 model front operator controls



Figure 5. PS4000 rear panel operator controls

1. Amperage Control - The amperage control selects the desired amperage within the entire range of the welding power source. Rotating this control in a clockwise direction increases the amperage output. The scale surrounding the control represents approximate actual amperage values.
2. Warning Indicator - The Warning Indicator located on the front panel will become activated under the following conditions:
 - Input voltage is too low
 - Input voltage is too high
 - Thermal overload
3. AC Power Indicator - The AC Power indicator located on the front panel lights when the PRIMARY POWER Switch is in the ON position, indicating the unit is energized.

4. Amperage Switch - This selector switch determines the adjustment of amperage. In the PANEL position, amperage is controlled by the front panel control. For remote amperage control, set the switch in the REMOTE 17 position. For Thermal Arc Plasma Welding and Plasma Welding accessories the 17 pin receptacle is used. For other remote operation of amperage control directly to the Power Supply use the REMOTE 14 position.
5. Output Contactor Switch - With the PRIMARY POWER Switch ON, open circuit voltage will be present at the weld output receptacle when the OUTPUT CONTACTOR SWITCH is in the ON position. For remote contactor control, set the switch in either the REMOTE 14 or REMOTE 17 position depending on which remote control receptacle is used. Open circuit voltage will be present at the weld output receptacles whenever the torch switch or remote device is closed.
6. 24V Circuit Breaker - Push to reset. Controls 24V power source for wire feeders controlled through the 14 pin receptacle.
7. 115V Circuit Breaker - Push to reset. Controls 115V power source for wire feeders controlled through the 14 pin receptacle.
8. Amperage/Voltage Selector Switch - Selects digital meter display of output amperage or voltage.
9. Preview Pushbutton Switch - Allows digital meter to be used to set amperage prior to welding for panel operation.
10. LED Display
11. Positive Terminal - 50mm DINZ-style female receptacle.
12. Negative Terminal - 50mmDINZ-style female receptacle.
13. 14-Pin Receptacle - Used with remote devices.
14. 17-Pin Receptacle - Used to interface to welding system.
15. Primary Power Switch - Places the Primary Power Switch (circuit breaker) located on the rear panel to the ON position energizes the welding power source.
16. Voltage Selector - Manual slide switch selects the proper input voltage range. If this slide is not set to the position that matches the input voltage from the electrical source the Smart Logic will inhibit welding power source turn on and the warning indicator will be illuminated. Not installed in 380-415V models.
17. Input Cable - 10 feet.

3.02 Setup for Operation

AMPERAGE SWITCH This switch determines whether the amperage is adjusted by the front panel AMPERAGE control or by a remote control device. If remote control function is not desired, place this switch in PANEL position.

For remote amperage control, place the AMPERAGE switch in REMOTE 14 position if remote control connections are made to the REMOTE 14 receptacle, or to the REMOTE 17 position if remote control connections are made to the REMOTE 17 receptacle.

When using the REMOTE 14 receptacle, remote control is a percentage of the value set by the front panel AMPERAGE control. For example, if the AMPERAGE control is set at half maximum output, the maximum output available from the remote control will be half the welding power source maximum output.

When using the REMOTE 17 receptacle, the REMOTE 17 receptacle commands the full range of the welding power source output, independent of the front panel AMPERAGE setting.

OUTPUT CONTACTOR If the OUTPUT CONTACTOR switch is in ON position, open circuit voltage will be present at the output receptacles whenever the PRIMARY POWER switch is in ON position.

NOTE Although the term Contactor is used on the nameplate and throughout this manual, the output is not switched on or off by a physical contactor; rather, the unit uses solid-state output control.

For remote contactor control, place the OUTPUT CONTACTOR switch in REMOTE 14 position if remote Contactor connections are made to the REMOTE 14 receptacle, or to the REMOTE 17 position if remote contactor connections are made to the REMOTE 17 receptacle. Open circuit voltage will be present at the weld output receptacles whenever the torch switch or remote device is closed.

3.02 Setup for Operation

Plasma Arc Welding (PAW)

WARNING Read and follow all safety precautions on pages 3-7 of this manual before proceeding with operation.

1. Install and connect unit according to the installation instructions in section 2.04, pages 18-20 of this manual.
2. Wear dry insulating gloves and clothing.
3. Connect work clamp to clean, bare metal on workpiece. For the majority of use, the work clamp is connected to the POSITIVE Dinz terminal.
4. Connect the NEGATIVE cable from the Plasma Welding Console to the NEGATIVE Dinz terminal of the PS4000.
5. Connect the WC100B interface cable (870119) to the PS4000 17 pin Receptacle.
6. Refer to Operator Control section, page 23-25, and set the controls per the following:
 - a. Rotate the AMPERAGE control [1] to output current level desired if in PANEL operation.
 - b. Set REMOTE CONTACTOR [5] and AMPERAGE SWITCH [4] to desired position. When connected to the Thermal Arc WC100B place the REMOTE CONTACTOR & REMOTE AMPERAGE Switches to the REMOTE 17 position.

- Shutting Down
14. Stop welding.
 15. Move the PRIMARY POWER switch [15] to the OFF position.
 16. Turn off the shielding gas and water supplies if applicable.

4.0 BASIC TROUBLESHOOTING

General Troubleshooting and repairing this unit is a process which should be undertaken only by those familiar with high voltage, high power electronic equipment.

WARNING There are extremely dangerous voltage and power levels present inside this unit. Do not attempt to diagnose or repair unless you have had training in power electronics measurement and troubleshooting techniques.

4.01 Common Welding Operation Faults

The following are some of the more common operating faults that occur during welding operations:

A. Power

- Main power not connected
- Main power not turned on
- MAIN CIRCUIT BREAKER set of OFF position
- INPUT SELECTOR (Easy Link) Switch in wrong position

B. Poor Weld

- Wrong polarity
- Wrong torch configuration
- Wrong Gas
- Incorrect welding amperage setting
- Speed too slow or too fast
- Incorrect switch settings for intended operation
- Poor weld output connection(s)

C. Remote Operation

- Incorrect contactor switch settings
- Remote device not connected

If the problem is not resolved after checking the above, the following guide may suggest more specific items to check given the faulty operating symptom(s) you are experiencing.

4.02 Specific Problems

How to Use This Guide The following information is a guide to help you determine the most likely causes for various symptoms.

This guide is set up in the following manner:

A. Symptom (Bold Type)

Any special instructions (Text Type)

1. Cause (Italic Type)

a. Check/Remedy (Text Type)

Locate your symptom, check the cause(s) (the simplest or most likely is listed first), then perform the remedy given. Repair as needed being sure to verify that the unit is

fully operational after any repairs.

A. No Weld Output; Unit is Completely Inoperative

1. Line disconnect switch is in OFF position
 - a. Place line disconnect switch in ON position.
2. Line fuse(s) open
 - a. Check and replace line fuse(s).
3. Improper electrical input connections
 - a. See Section 2.04 Electrical Input Requirements, page 17, for proper input connections.
4. MAIN CIRCUIT BREAKER in OFF position
 - a. Check and reset MAIN CIRCUIT BREAKER if necessary.
5. INPUT SELECTOR (Easy Link) switch is set to incorrect position for applied input voltage
 - a. Verify primary source voltage and set INPUT SELECT switch to correct setting.

B. WARNING Indicator is ON

1. Unit is in thermal shutdown mode
 - a. Allow cooling period of approximately five (5) minutes with the power ON. Duty cycle should be reviewed. To reset the WARNING indicator, the power supply must be turned OFF, then ON again.
 - b. Measure input voltage and verify that it matches the INPUT SELECTOR (Easy Link) switch setting. The length of the input power cable must be considered, as there will be a considerable voltage drop along its length.

C. Erratic or Improper Weld Output

1. Loose welding cable connections
 - a. Tighten all welding cable connections.
2. Incorrect welding cable size
 - a. Use proper size and type of cable (see Table 2, page 31).
3. Improper input connections
 - a. Refer to Section 2.04 Electrical Input Connections, page 17.
4. Poor torch condition
 - a. Inspect torch setup.
5. Wrong welding polarity
 - a. Verify output torch connections.

E. Green AC POWER Indicator OFF; Fan Not Operating

1. Input line disconnect switch in OFF position
 - a. Place input line disconnect switch to ON position.
2. Power supply MAIN CIRCUIT BREAKER (MCB) in OFF position
 - a. Place MCB to ON position.
3. Input line breaker tripped/fuses blown
 - a. Check primary supply breaker or fuses and replace if necessary.

NOTE Verify that for single-phase operation, the RED input line is not connected.

4. Open conductor in input power line
 - a. Check continuity and replace if necessary.

F. Red WARNING Indicator ON; No Weld Output

1. Thermal sensor TH1 open (thermal shutdown)

- a. Allow the unit to cool for five minutes before turning the power supply ON.
2. Input voltage fluctuation causing protection circuits to activate
 - a. Monitor input power for spikes and high voltage condition. Most power utilities will monitor and verify line voltage.

G. Front Panel 24V or 115V Circuit Breaker(s) Trips When Remote Contactor Points are Closed or, when the AMPERAGE Selector in PANEL Position.

1. Faulty remote device

H. No Weld or Output; Fan Operating; WARNING Indicator OFF

1. OUTPUT CONTACTOR selector in REMOTE 14 position with no remote contactor connected
 - a. Place OUTPUT CONTACTOR selector to ON position or connect remote contactor control to remote receptacle.
2. Faulty Remote Control Device
 - a. Set OUTPUT CONTACTOR selector to ON position and AMPERAGE/VOLTAGE selector to PANEL position. If amperage and voltage can be adjusted with front panel controls, repair or replace remote control device.
3. Line voltage is too high
 - a. Verify that input voltage matches setting on rear panel INPUT SELECTOR switch.

I. Low or Maximum Weld Output With No Control

1. Faulty remote control device
 - a. Set OUTPUT CONTACTOR selector to ON position and AMPERAGE selector to PANEL position. If amperage can be adjusted with front panel controls, repair or replace remote control device.

J. Limited Weld Output

1. Poor primary input voltage
 - a. Check primary input voltage is within $\pm 10\%$ of nominal voltage, i.e. 230VAC $\pm 10\%$.

K. Erratic or Improper Weld Output

1. Loose welding cable connections
 - a. Tighten all welding cable connections.
2. Improper setup
 - a. Check for proper connection of input power.
3. Faulty Remote Device
 - a. Check all remote devices and repair or replace if necessary.

L. No 115VAC or 24VAC at 14-Pin Connector

1. Front panel circuit breakers are tripped
 - a. Reset front panel circuit breakers.

M. No Weld Output; Fan Not Operating; WARNING Indicator OFF


1. Line voltage too low
 - a. Verify that input voltage matches setting on rear panel INPUT SELECTOR switch.
2. Incompatible remote control device
 - a. Verify remote device wiring matches receptacle.
3. Faulty remote control device
 - a. Jumper output contractor. If unit produces output, the remote device is faulty.

4.03 REMOTE 14-Pin Connections

The REMOTE 14-Pin receptacle is used to connect any of the following equipment to the welding power source circuitry:

- Remote Contactor Control
- Remote Amperage Control
- Fixture

To make connections, align keyway, insert plug, and rotate threaded collar fully clockwise. The socket information is included in the event the supplied cord is not suitable and it is necessary to wire a plug or cord to interface with the REMOTE 14-Pin receptacle.

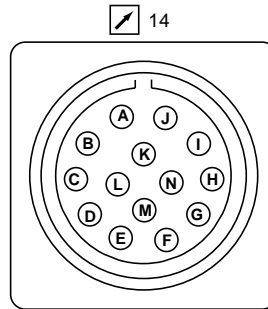

Socket	Function
A	Up to 10 amps of 24 VAC, 60Hz, with respect to Socket G (circuit common); protected by circuit breaker MCB3
B	Input to energize the solid-state contactor; 24 VAC (contact closure is provided between Sockets A and B to energize the solid-state contactor)
C	Amperage remote control (MAXIMUM) input command signal; +10 volts for maximum
D	Amperage remote control (MINIMUM); PC board common; use as return for remote control inputs/outputs
E	Remote amperage reference signal (WIPER); 0 to +10 volts (peak current set by main rheostat) in CC or CV mode
F	Not used
G	24 and 115 VAC circuit common; also connected to welding power source chassis
H	Not used
I	Up to 1.5 amperes of 115 VAC, 60Hz, with respect to Socket G (circuit common); protected by circuit breaker MCB2
J	115 VAC input control to energize solid state contactor (contact closure is provided between Sockets I and J)
K	Chassis common
L	Not used
M	Not used
N	Not used


Figure 7. REMOTE 14-Pin Connections

4.03 REMOTE 17-Pin Connections

The REMOTE 17-Pin receptacle provides a junction point for connecting various remote controls to the welding power source. The functions available from this receptacle are:

- Remote MIG synergic and Manual MIG Pulsers
- Remote Control
- Weld current and voltage signals for remote metering


To make connections, align keyway, insert plug, and rotate threaded collar fully clockwise. The socket information is included in the event the supplied cord is not suitable and it is necessary to wire a plug or cord to interface with the REMOTE 17-Pin receptacle.

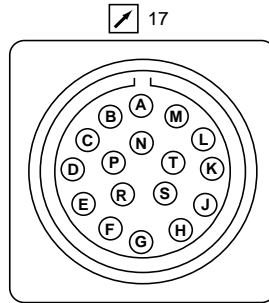

Socket	Function
A	Amperage/voltage reference output signal; +10 volts; for use with pulse controls
B	Amperage/voltage remote control input command signal; +10 volts for machine maximum
C	Not used
D	Solid-state contactor remote control command signal; +24 volts (operates above 13 volts) turns contactor on; 0 volts (open or ground) turns contactor off
E	Actual weld current signal; +1 volt per 100 amperes of output current
F	PC board common; use as return for remote control inputs/outputs only from terminals A, B, C, D, E, J and K
G	Not used
H	+24 volts unregulated; fused for 1/2 ampere
J	Not used
K	Remote amperage/voltage reference signal; 0 to +10 volts (set by main rheostat) in CC and CV mode
L	-24 volts unregulated; fused for 1/2 ampere
M	Load voltage output signal; +1 volt per 10 volts of load voltage
N	Not used
P	Circuit common (PC board common and internal chassis ground) use as return (\pm) 18 volts logic supply only (pins H and L)
R	Not used
S	Chassis ground
T	Not used

Figure 8. REMOTE 17-Pin Connections

APPENDIX A – SYSTEM CONFIGURATION

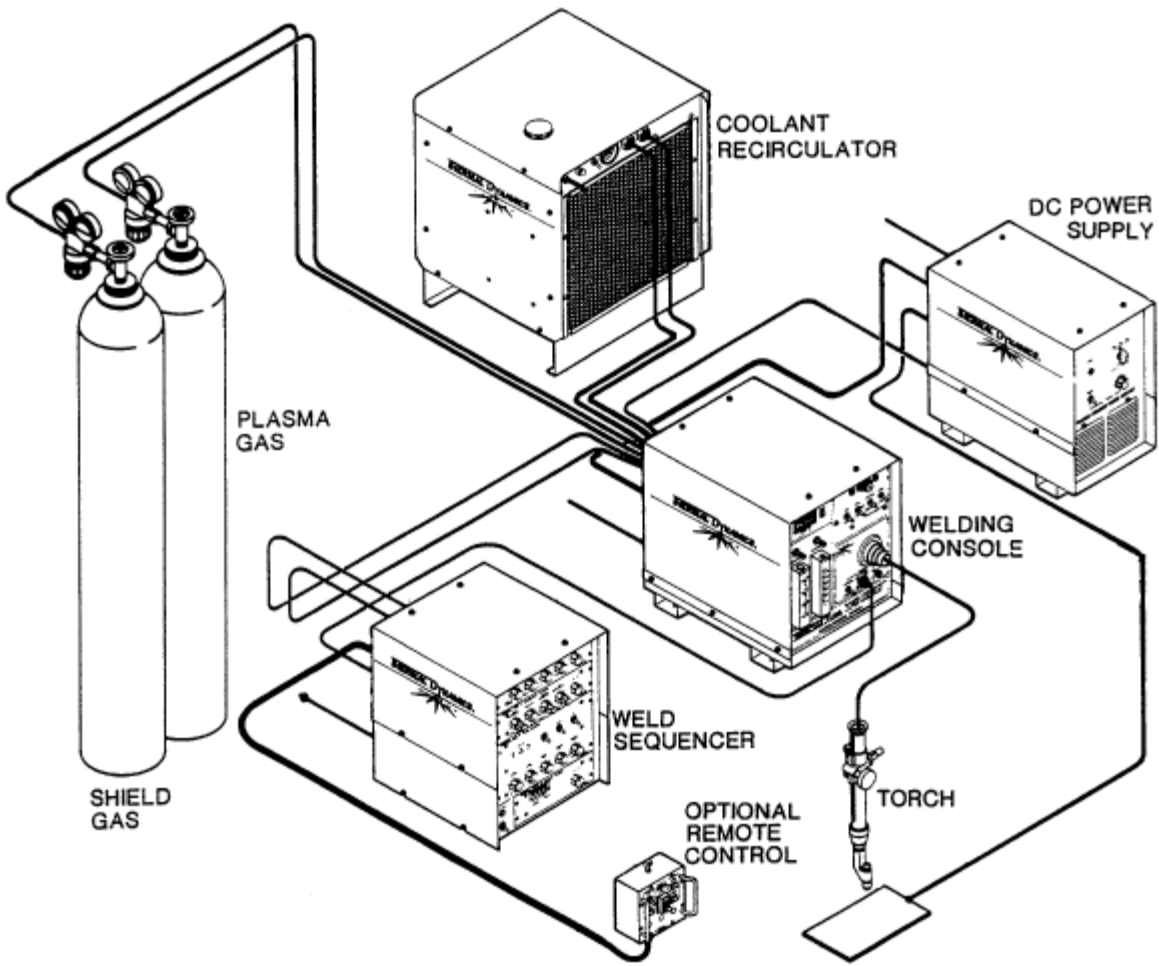

REPLACEMENT PARTS

Parts List –

DESCRIPTION	LOCATION	QTY.	230/460	380/415	460/575
Main PCB	PCB1	1	10-5514	N/A	N/A
Main PCB	PCB1	1	N/A	10-5512	N/A
Main PCB	PCB1	1	N/A	N/A	10-5519
Fan Assembly		1	10-5092	10-5092	10-5092
Input Rectifier		1	10-2653	N/A	N/A
Input Rectifier		1	N/A	10-5088	10-5088
IGBT Kit		2	10-6319	10-6319	10-6323
Main Circuit Breaker		1	10-6322	10-6322	N/A
Main Circuit Breaker		1	N/A	N/A	9-1076
Output Diodes	D2, D3	2	10-2630	10-2630	10-2630
Front Panel PCB	PCB6	1	10-6356	10-6356	10-6356
Front Upper Metal Panel		1	10-6352	10-6352	10-6352
Rear Upper Metal Panel		1	10-6355	N/A	N/A
Rear Upper Metal Panel		1	N/A	10-6357	N/A
Rear Upper Metal Panel		1	N/A	N/A	10-6358
Front Plastic Frame		1	10-5361	10-5361	10-5361
Rear Plastic Frame		1	10-5521	10-5521	10-5521
Female Output Terminal		2	10-5131	10-5131	10-5131
Male Output Terminal		2	10-2020	10-2020	10-2020
14 Pin Remote		1	10-5107	10-5107	10-5107
17 Pin Remote		1	10-5108	10-5108	10-5108
Easylink Switch		1	10-5222	N/A	10-5222
Input Power Cable		1	10-5239	10-5239	10-5239
Input Cable Clamp		1	10-5409	10-5409	10-5409
Digital Meter Kit		1	10-4000	10-4000	10-4000
Meter Lens		1	10-6340	10-6340	10-6340
Meter PCB	PCB7	1	10-5126	10-5126	10-5126
15 Pin Ribbon Cable		1	10-5234	10-5234	10-5234
12 Pin Ribbon Cable		1	10-5235	10-5235	10-5235
11 Pin Ribbon Cable		1	10-5236	10-5236	10-5236
Bus Bar		1	10-5412	10-5412	10-5412
Bus Bar		1	10-5413	10-5413	10-5413


Parts List – (cont.)

DESCRIPTION	LOCATION	QTY.	230/460	380/415	460/575
Bus Bar		1	10-5414	10-5414	10-5414
Bus Bar		1	10-5441	10-5441	10-5441
Capacitor	C1	1	10-2270	10-2270	10-2270
Capacitor	C8	1	10-5013	10-5013	10-5013
Capacitor	C6, C7	2	10-2219	10-2219	10-2219
Capacitor	C2, C3	2	10-5014	10-5014	10-5014
Case Half		2	10-5461	10-5461	10-5461
Label, caution		1	10-5496	10-5496	10-5496
Label, caution		1	10-5497	10-5497	10-5497
Chassis		1	10-5482	10-5482	10-5482
Current Transformer	CT1	1	10-5003	10-5003	10-5003
Diode	D4	1	N/A	N/A	10-2264
Dust cover	14 & 17 pin remote	2	10-5225	10-5225	10-5225
Ferrite ring(bead)	L1		10-2290	10-2290	10-2290
Filter board (CE)	PCB101	1	N/A	10-5517	N/A
Acrylic board		1	10-5424	10-5424	10-5424
Holder			10-5249	10-5249	10-5249
Inductor	FCH	1	10-5477	10-5477	10-5477
Knob, output control		1	10-5233	10-5233	10-5233
Knob, small		2	10-5232	10-5232	10-5232
Line Filter (CE)	L104	1	N/A	10-5229	N/A
Line Filter (CE)	L102, L103	2	N/A	10-5230	N/A
Line Filter (CE)	L104, L105	2	N/A	10-5231	N/A
Main Transformer	T1, T2	2	10-5152	N/A	N/A
Main Transformer	T1, T2	2	N/A	10-5467	N/A
Main Transformer	T1, T2	2	N/A	N/A	10-5468
Main Circuit Breaker Metal Shield		1	10-5484	10-5484	10-5484
Process Switch	Stick, MIG, Lift TIG	1	10-5570	10-5570	10-5570
Contacto Switch		1	10-5570	10-5570	10-5570
Output remote/ local switch		1	10-5570	10-5570	10-5570
Insulation sheet (CE)		1	N/A	10-5448	N/A
Output Bus Bar		1	10-5440	10-5440	10-5440
Clip, PCB Cover		3	P058000830	P058000830	P058000830
PCB Cover sheet		1	10-5419	10-5419	10-5419
Potentiometer, Hot Start & Arc Control		2	10-5056	10-5056	10-5056
Potentiometer, Output Control		1	10-5221	10-5221	10-5221
Protection Bar			10-5443	10-5443	10-5443
Bus Bar		1	10-5415	10-5415	10-5415
Rubber Foot		4	10-5411	10-5411	10-5411


Parts List – (cont.)

DESCRIPTION	LOCATION	QTY.	230/460	380/415	460/575
Label, side		2	10-5498	10-5498	10-5498
Spacer, bushing, PCB			10-5250	10-5250	10-5250
Spacer, sleeve, PCB			10-5253	10-5253	10-5253
Thermister	TH1	1	10-5228	10-5228	10-5228
IGBT Snubber PCB	PCB4, 5	2	10-5121	10-5121	N/A
IGBT Snubber PCB	PCB4, 5	2	N/A	N/A	10-5122
IGBT Gate PCB	PCB2, 3	2	10-5120	10-5120	10-5120
PCB8	PCB8	1	N/A	N/A	10-5127

SYSTEM SCHEMATIC - 230/460

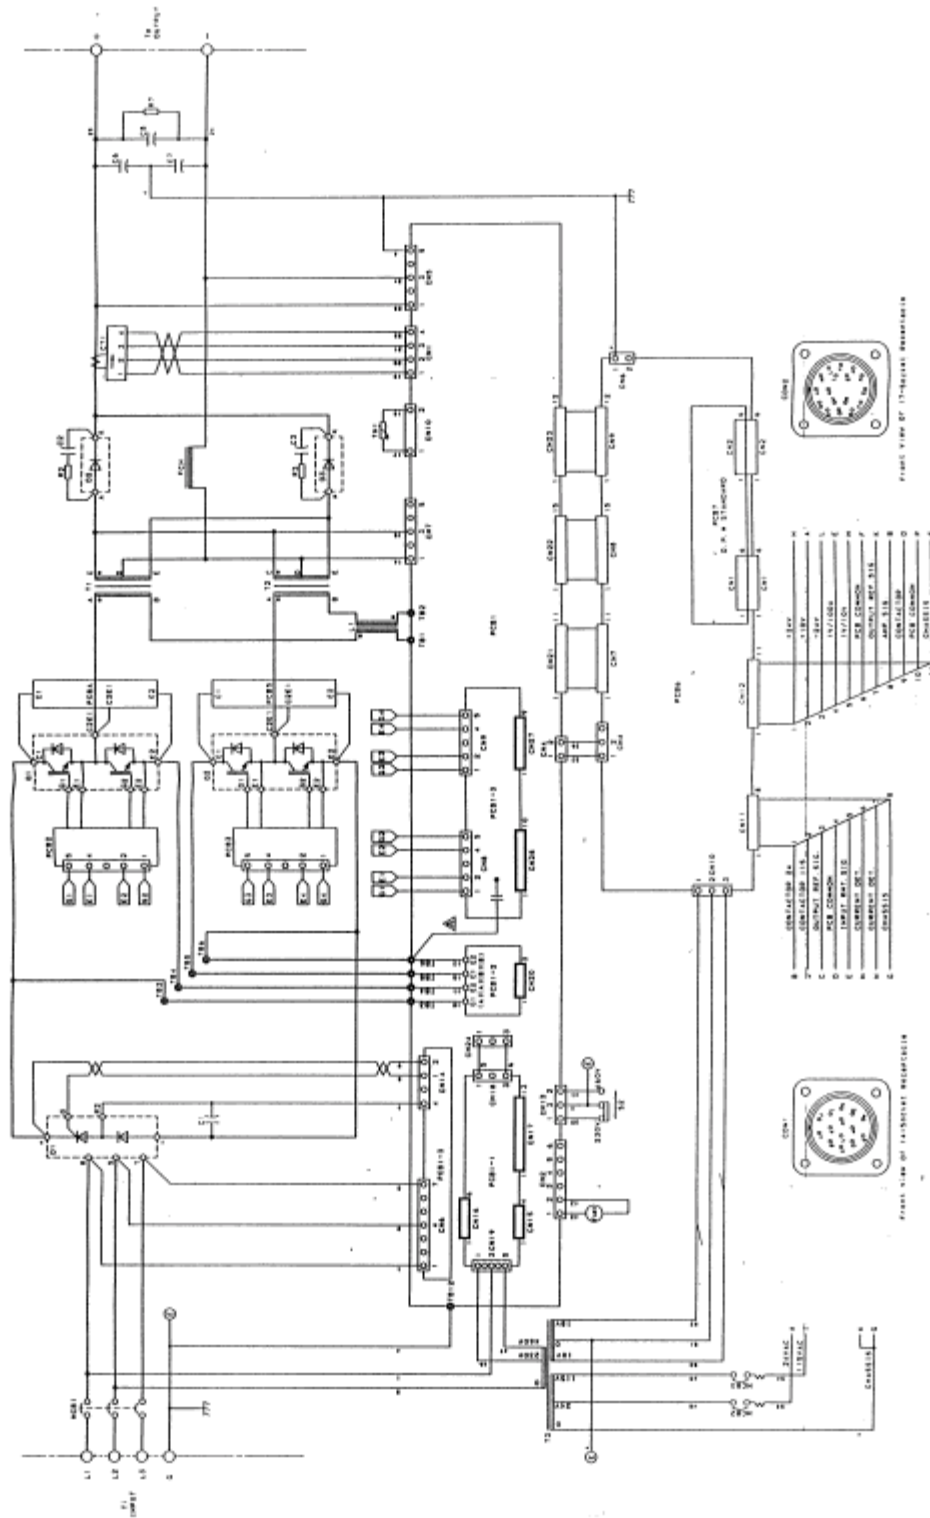

SYSTEM SCHEMATIC - 380-415

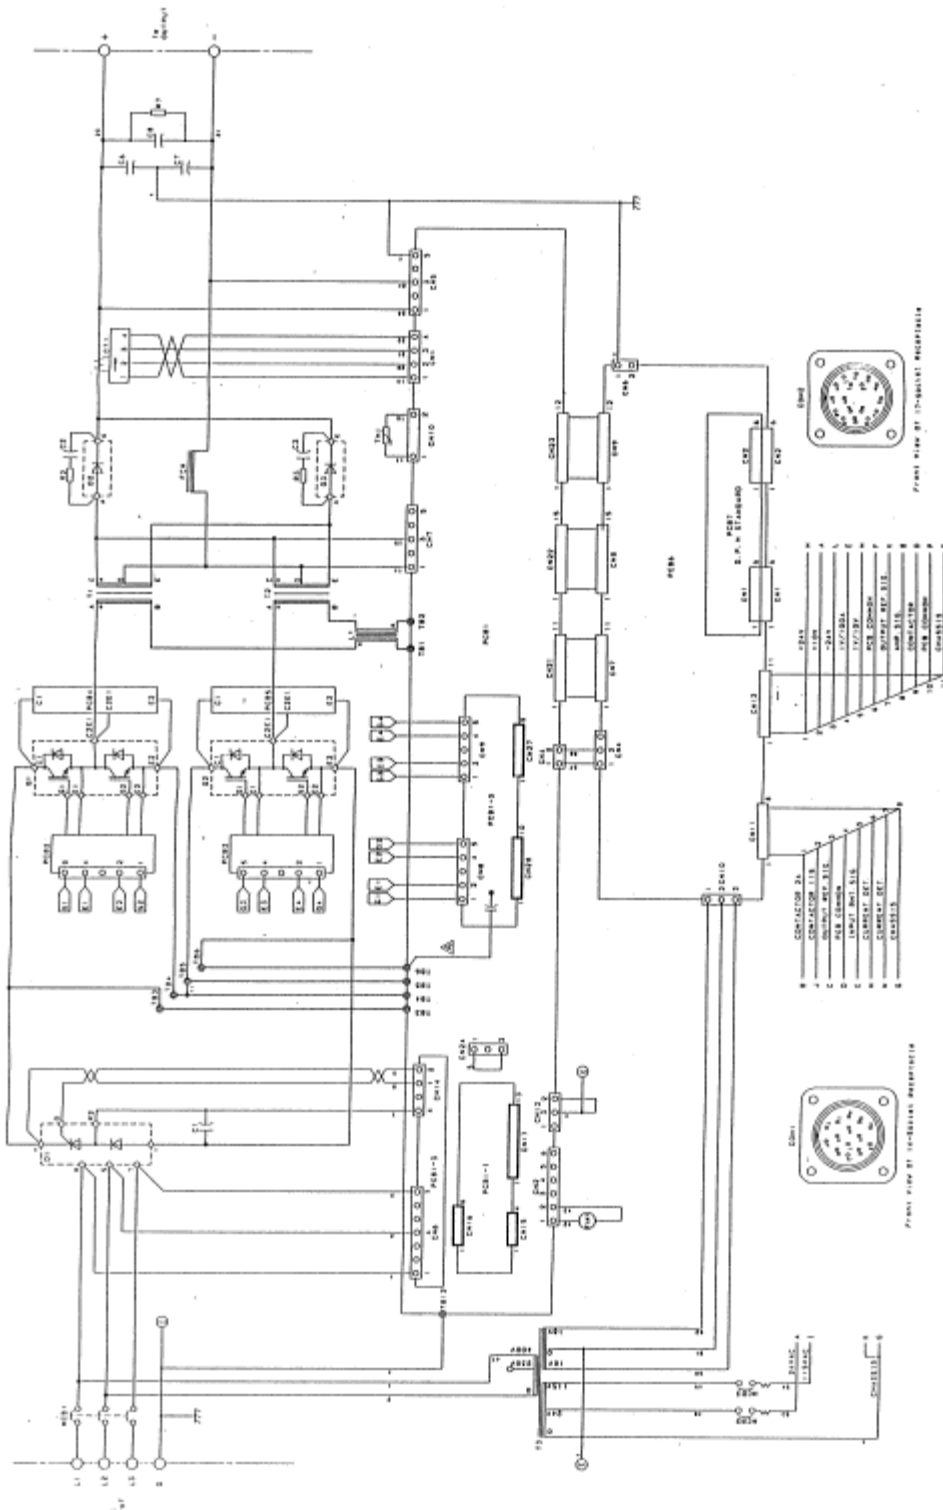

SYSTEM SCHEMATIC - 460/575

